5-Bit 2:1 Mux-Latch

The MC10E/100E154 contains five 2:1 multiplexers followed by transparent latches with differential outputs. When both Latch Enables (LEN1, LEN2) are LOW, the latch is transparent, and output data is controlled by the multiplexer select control, SEL. A logic HIGH on either LEN1 or LEN2 (or both) latches the outputs. The Master Reset (MR) overrides all other controls to set the Q outputs LOW.

- 850ps Max. LEN to Output
- 825ps Max. D to Output
- Differential Outputs
- · Asynchronous Master Reset
- Dual Latch-Enables
- Extended 100E VFF Range of 4.2V to 5.46V
- 75kΩ Input Pulldown Resistors

Pinout: 28-Lead PLCC (Top View) D_{3b} D_{4b} D_{3a} Q_4 Q_4 V_CCO SEL 18 Q_3 LEN1 17 Q_3 LEN2 16 **VCC** VEE [(1) 15 Q_2 MR 14 | Q₂ D_{0a} 13 ∏ Q₁ D_{0b} 12 🔲 Q₁ D_{1b} D_{2a} D_{2b} **VCCO**

 * All VCC and VCCO pins are tied together on the die.

PIN NAMES


Pin	Function
D _{0a} – D _{4a}	Input Data a
$D_{0a} - D_{4a}$ $D_{0b} - D_{4b}$	Input Data b
SEL	Data Select Input
LEN1, LEN2	Latch Enables
MR	Master Reset
$Q_0 - Q_4$	True Outputs
$Q_0 - Q_4$	Inverted Outputs

TRUTH TABLE


SEL	Data
Н	a
L	b

MC10E154 MC100E154

5-BIT 2:1 MUX-LATCH

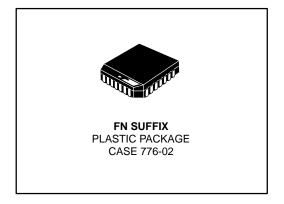

LOGIC DIAGRAM

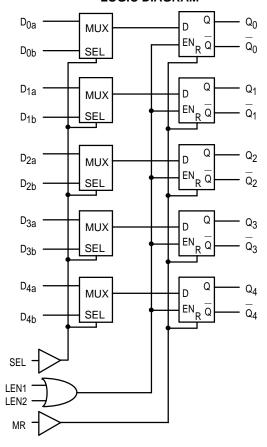

MOTOROLA

REV 2

12/93

© Motorola, Inc. 1996

DC CHARACTERISTICS (VEE = VEE(min) to VEE(max); VCC = VCCO = GND)

		0°C			25°C			85°C				
Symbol	Characteristic	min	typ	max	min	typ	max	min	typ	max	Unit	Condition
lн	Input HIGH Current			150			150			150	μΑ	
IEE	Power Supply Current										mA	
	10E		76	91		76	91		76	91		
	100E		76	91		76	91		87	105	1	


AC CHARACTERISTICS ($V_{EE} = V_{EE}(min)$ to $V_{EE}(max)$; $V_{CC} = V_{CCO} = GND$)

		0°C			25°C			85°C				
Symbol	Characteristic	min	typ	max	min	typ	max	min	typ	max	Unit	Condition
tPLH	Propagation Delay to Output										ps	
tPHL	D	325	500	700	325	500	700	325	500	700		
	SEL	475	650	925	475	650	925	475	650	925		
	LEN	350	500	750	350	500	750	350	500	750		
	MR	450	600	800	450	600	800	450	600	800		
t _S	Setup Time										ps	
	D	300	100		300	100		300	100			
	SEL	500	250		500	250		500	250			
th	Hold Time										ps	
	D	300	-100		300	-100		300	-100			
	SEL	200	- 250		200	- 250		200	- 250			
t _{RR}	Reset Recovery Time	800	600		800	600		800	600			ps
tpW	Minimum Pulse Width										ps	
	MR	400			400			400				
tSKEW	Within-Device Skew		50			50			50		ps	1
t _r	Rise/Fall Times										ps	
t _f	20 - 80%	300	475	800	300	475	800	300	475	800		

^{1.} Within-device skew is defined as identical transitions on similar paths through a device.

MOTOROLA 2–2

OUTLINE DIMENSIONS

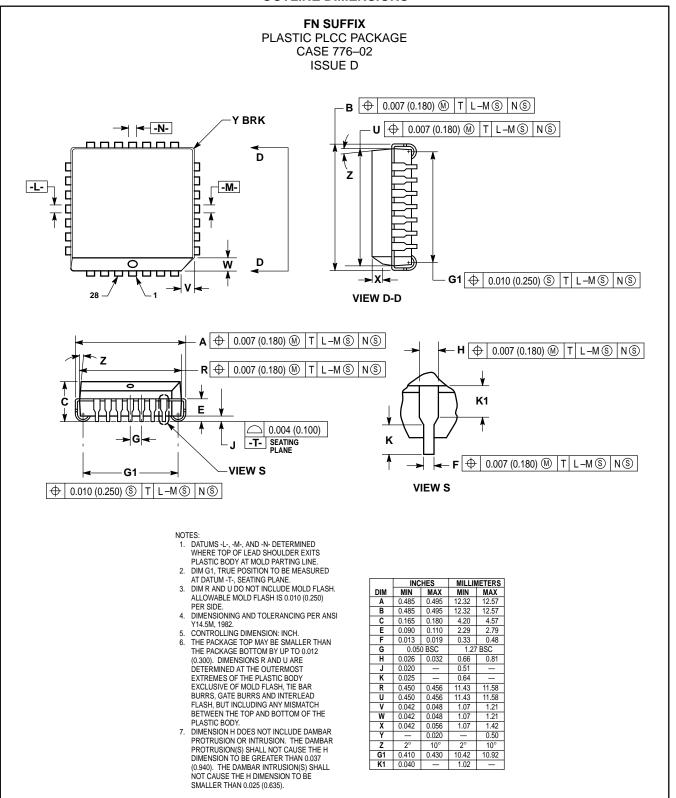

MC10E154 MC100E154

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters which may be provided in Motorola data sheets and/or specifications can and do vary in different applications and actual performance may vary over time. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part. Motorola and was negligent regarding the design or manufacture of the part. Motorola and are registered trademarks of Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer.

How to reach us:

USA/EUROPE/Locations Not Listed: Motorola Literature Distribution; P.O. Box 20912; Phoenix, Arizona 85036. 1–800–441–2447 or 602–303–5454

MFAX: RMFAX0@email.sps.mot.com - TOUCHTONE 602-244-6609 INTERNET: http://Design-NET.com

JAPAN: Nippon Motorola Ltd.; Tatsumi–SPD–JLDC, 6F Seibu–Butsuryu–Center, 3–14–2 Tatsumi Koto–Ku, Tokyo 135, Japan. 03–81–3521–8315

ASIA/PACIFIC: Motorola Semiconductors H.K. Ltd.; 8B Tai Ping Industrial Park, 51 Ting Kok Road, Tai Po, N.T., Hong Kong. 852–26629298





Copyright © Each Manufacturing Company.

All Datasheets cannot be modified without permission.

This datasheet has been download from:

www.AllDataSheet.com

100% Free DataSheet Search Site.

Free Download.

No Register.

Fast Search System.

www.AllDataSheet.com